



# SERVICE BULLETIN



**WORL DLAWN POWER EQUIPMENT, INC.**

**Bulletin Number: SB1101**

Date: 6/21/2011

To Distributers and Dealers:

**Model:** WYZ48/52/60 & WYRZ50 Zero Turn Models

**Subject:** In a continuing effort to improve product, we have changed to a new grommet style. Field reports have indicated that tank leakage may occur. When replacing grommet, increase the hole size to 17/32". Please contact dealers and various customers that this may affect.

**Procedure:**

- Move mower to well-ventilated area preferably outdoors (fuel spillage may occur).
- Switch 3-way fuel valve by foot plate to the "Off" position.
- Remove fuel line from engine.
- Place end of fuel line in appropriate fuel storage container and drain tank to be worked on.
- Remove right angle connector and grommet from bottom of tank. (Grasp connector firmly with vise grip or pliers and pull in a downward motion.)
- Ensure that all fuel has drained from tank.
- Remove bolts from tank mounts, tip tank, and drill hole to 17/32" diameter.
- Lubricate new grommet (PN533125) with P-80 THIX Rubber Lubricant Gel or an equivalent product (not harmful to rubber products). Insert grommet into drilled hole and push right angle connector into grommet. (Make certain that grommet is seated firmly and evenly.)
- Ensure that fuel line is attached and clamped into place.
- Reinstall tank to mounts.
- Repeat procedure on opposite side.
- Reattach fuel line to engine and switch 3-way fuel valve to LH or RH tank.
- Refill fuel tanks and check for leaks. Clean any fuel residue which may have been spilled.

