



# SERVICE BULLETIN



**WORLDLAWN POWER EQUIPMENT, INC.**  
2415 Ashland Ave  
Beatrice, NE 68310  
(402) 228-4255

**Bulletin Number: SB1402**

**Date: 2/20/14**

**Product Affected:** WYS52FX730V stand on mowers with serial numbers 201304U00192 through 201308U00534

**Situation:** We had several field reports of difficulty starting units as the brake switch was not being fully actuated. We heard comments that the brake lever was lifting back off the brake switch when the rod came over center. We also had several complaints of the brake bracket and brake linkage bending.

**Solution:** We identified a manufacturing issue in the construction of the brake rod cross shaft that engaged the tires when the brake was set. This was corrected early in the production build schedule at serial number 201304U00298. We also improved the strength of the brake bracket and brake linkage.

**Required Action:** Should you have a unit exhibiting the conditions as noted above you may install the new components and receive warranty reimbursement.

**Parts Required:** Qty 1 each of the following.  
452094-1 brake shaft  
453296-2 brake bracket  
453402 brake linkage

**Warranty:** Warranty will cover the cost of the parts and labor to install them.

**Note:** The brake shaft issue only affected units with serial numbers 201304U00192 to 201304U00298.